



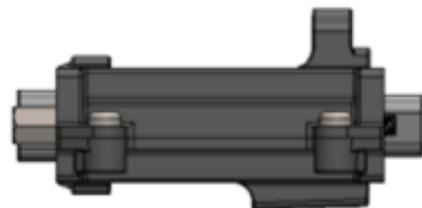

## AV-Link PMA

# STC Service Bulletin

## Software Upgrade to 0.3.7

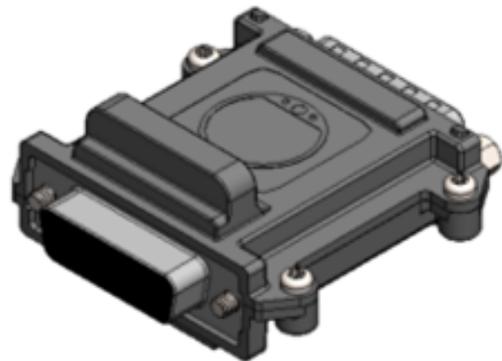

# COPYRIGHT AND PRIVACY NOTICE

© 2025 uAvionix Corporation. All rights reserved.

uAvionix Corporation

Bigfork, MT

[www.uavionix.com](http://www.uavionix.com)

[support@uavionix.com](mailto:support@uavionix.com)

Except as expressly provided herein, no part of this guide may be reproduced, transmitted, disseminated, downloaded, or stored in any storage medium, for any purpose without the express written permission of uAvionix. uAvionix grants permissions to download a single copy of this guide onto an electronic storage medium to be viewed for personal use, provided that the complete text of this copyright notice is retained. Unauthorized commercial distribution of this manual or any revision hereto is strictly prohibited.

uAvionix® and Ping® are registered trademarks of uAvionix Corporation and may not be used without express permission of uAvionix.

AV-30, AV-30-E, AV-30-C, AV-Mag, AV-Link, AV-APA, AV-HSI, BeaconX, tailBeaconX, echoESX, and skyBeaconX are trademarks of uAvionix Corporation and may not be used without express permission of uAvionix.

Patents:

[www.uavionix.com/patents](http://www.uavionix.com/patents)

# 1. Revision History

Revision	Date	Comments
A	11/21/2025	Initial Release

## **2. Warnings / Disclaimers**

uAvionix is not liable for damages arising from the use or misuse of this product.

This equipment is classified by the United States Department of Commerce's Bureau of Industry and Security (BIS) as Export Control Classification Number (ECCN) 7A994.

These items are controlled by the U.S. Government and authorized for export only to the country of ultimate destination for use by the ultimate consignee or end-user(s) herein identified. They may not be resold, transferred, or otherwise disposed of, to any other country or to any person other than the authorized ultimate consignee or end-user(s), either in their original form or after being incorporated into other items, without first obtaining approval from the U.S. government or as otherwise authorized by U.S. law and regulations.

### 3. Table of Contents

#### Contents

1.	Revision History .....	3
2.	Warnings / Disclaimers .....	4
3.	Table of Contents .....	5
4.	Planning Information .....	6
4.1.	Distribution / Eligibility .....	6
4.2.	Applicability .....	6
4.3.	Description .....	6
4.4.	Time Required .....	7
4.5.	Weight and Balance .....	7
4.6.	Electrical Load Data .....	7
4.7.	Applicable Publications .....	7
5.	Required Items .....	8
5.1.	Windows PC or Apple iOS device With Wifi PC with Serial Port .....	8
6.	Update Notes .....	9
7.	AV-Link PMA Update Procedure .....	10
8.	Post-Accomplishment Verification and Actions .....	14
9.	System Checkout .....	14
10.	Support .....	14
11.	Maintenance Record .....	15

## 4. Planning Information

### 4.1. Distribution / Eligibility

The Accomplishment Instructions contained in Section 8 may only be performed by appropriately authorized personnel.

### 4.2. Applicability

This Service Bulletin applies to AML STC SA00410BO for the uAvionix AV-Link PMA UAV-1004414-001 with operating software release 0.3.5 or earlier.

Use Table 1 to determine applicability of the software update.

Hardware P/N Marking	Applicability
UAV-1004414-001	Verify by procedure

Table 1: Applicability

Parts identified above as “Verify by procedure” may have software release 0.3.5 or previous installed. To determine what version of software is installed:

1. Connected to the AV-Link PMA with a PC or Apple iOS device following the instructions in TBD.
2. If the AV-Link PMA version displayed on the web page is 0.3.5, proceed with this service bulletin.
3. If the AV-Link PMA version is prior to 0.3.5, apply the 0.3.5 service bulletin first and then this service bulletin. The 0.3.5 service bulletin and related files are available at <https://uavionix.com/service-bulletin/av-link-c-pma-service-bulletin-software-upgrade-0-3-5/>

### 4.3. Description

This Service Bulletin provides instructions for loading uAvionix AV-Link PMA UAV-1004414-001 with updated software release 0.3.7.

#### 4.4. Time Required

For software only update in the field, up to 30 minutes is required to perform this update procedure.

#### 4.5. Weight and Balance

No change

#### 4.6. Electrical Load Data

No change

#### 4.7. Applicable Publications

The following documents are applicable to AV-Link PMA software release 0.3.7.

<b>Title</b>	<b>Part Number</b>	<b>Revision</b>
AV-30-C Installation Manual	UAV-1003947-001	R
AV-30-C Pilot's Guide	UAV-1003946-001	K

*Table 2: Applicable documents*

## 5. Required Items

Download the software update file below.

Filename	Version	SW Part Number	SHA1 Hash
UAV-1007753-003_AV-Link_V0_3_7-6bc8eb50.bin	0.3.7	UAV-1007753-003	fa7594201c172396834929828627ec67b3de90de

Table 3: Software Update Files

uAvionix software update files are available for download from the uAvionix Support website at no charge, at:

<https://uavionix.com/support/av-link-pma/>

Ensure the software and any necessary update tools have been downloaded prior to visiting the aircraft. An internet connection is required to download the software and application. An internet connection is not required to perform the update.

### 5.1. Windows PC or Apple iOS device With Wifi PC with Serial Port

The following items are required to perform the update:

Quantity	Description
1	Windows PC running Windows 7 or later or iOS device
1	802.11 Wi-Fi interface
1	A supported web browser: -Windows PC with Google Chrome -Windows PC with Microsoft Edge -iPhone or iPad with Safari (must be in airplane mode with Wi-Fi on)
1	AV-Link PMA Software as shown in Table 3

## **6. Update Notes**

All AV-Link PMA configuration settings will be preserved during the update procedure. However, please take note of all settings before performing the update and verify settings are correct after the update has been applied.


The AV-Link PMA must already be running 0.3.5 to perform this update. If it isn't, apply the 0.3.5 service bulletin referenced in Section 4.2. If the AV-Link PMA is not already running 0.3.5 it may reject this update file.

## 7. AV-Link PMA Update Procedure

The AV-Link PMA acts as a Wi-Fi hotspot to which your PC or mobile device will connect. If you are using a phone or a tablet, put it in airplane mode first, then enable Wi-Fi to avoid being connected to multiple networks at once.


The following instructions show the update procedure when using a Windows PC. Apply the same procedures, modified as necessary, when using an iPhone or iPad.

1. Apply power to the AV-Link PMA. Do not interrupt power during the update process.
2. If using an Apple iPhone or iPad, you must put the device into Airplane Mode, then turn on Wi-Fi only.
3. Connect a PC to the AV-Link PMA Wi-Fi Network. This will be displayed as AV\_#### where #### will be 4 random characters ranging from 0-8 and A-F.

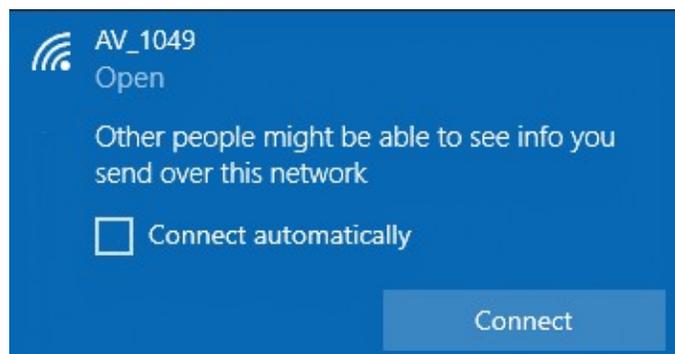

4. In a Web Browser (such as Google Chrome) navigate to the AV-Link PMA home page via the following URL: [192.168.5.1](http://192.168.5.1)

5. Verify that the version is at least 0.3.5. Click the AV-Link software version link.

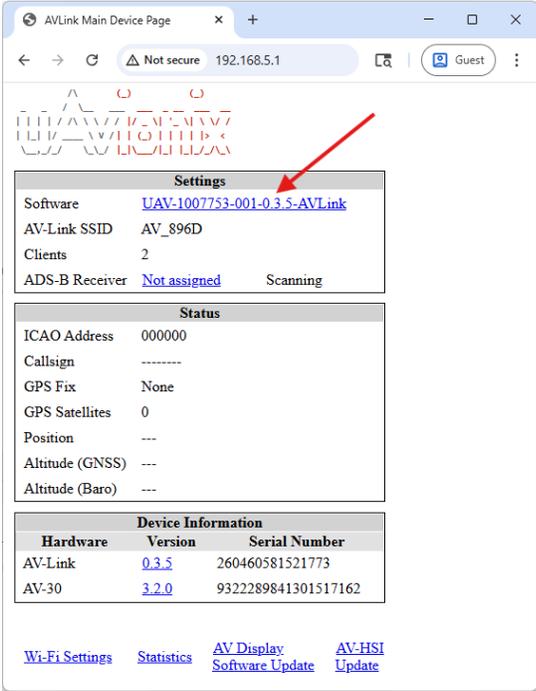

The screenshot shows a web browser window titled "AVLink Main Device Page" with the address bar displaying "192.168.5.1". The page content is organized into several sections:

- Settings:** A table with the following entries:


Software	<a href="#">UAV-1007753-001-0.3.5-AVLink</a>	
AV-Link SSID	AV_896D	
Clients	2	
ADS-B Receiver	Not assigned	Scanning
- Status:** A table with the following entries:

ICAO Address	000000
Callsign	-----
GPS Fix	None
GPS Satellites	0
Position	---
Altitude (GNSS)	---
Altitude (Baro)	---
- Device Information:** A table with the following entries:


Hardware	Version	Serial Number
AV-Link	<a href="#">0.3.5</a>	260460581521773
AV-30	<a href="#">3.2.0</a>	9322289841301517162

At the bottom of the page, there are four links: [Wi-Fi Settings](#), [Statistics](#), [AV Display Software Update](#), and [AV-HSI Update](#). A red arrow points to the "UAV-1007753-001-0.3.5-AVLink" link in the Settings section.

6. On the Wi-Fi Software Update page click "Choose File"

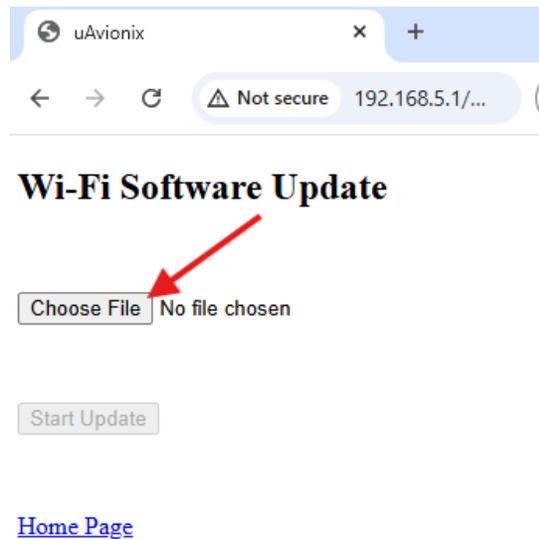


7. Select the previously downloaded update file, as specified in Table 3.

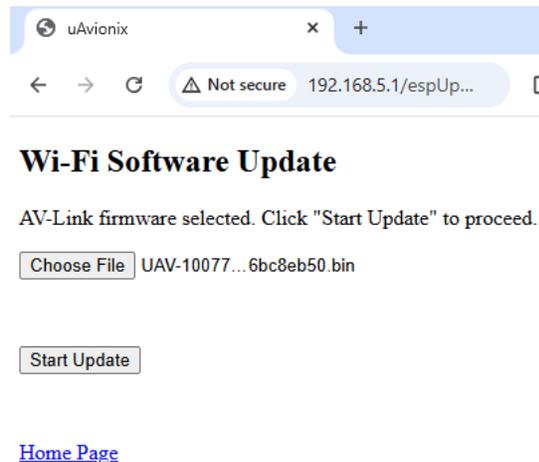


8. Click "Start Update". Update progress will be displayed on screen. The AV-Link PMA will redirect back to the homepage when finished. The update should take less than 2 minutes. If it takes longer, contact uAvionix technical support.

9. On the homepage, verify that the new software version matches the version specified in Table 3.

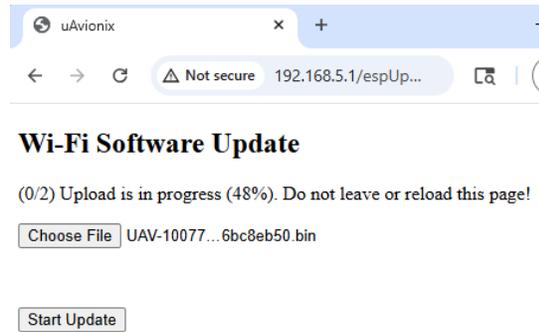

[Home Page](#)

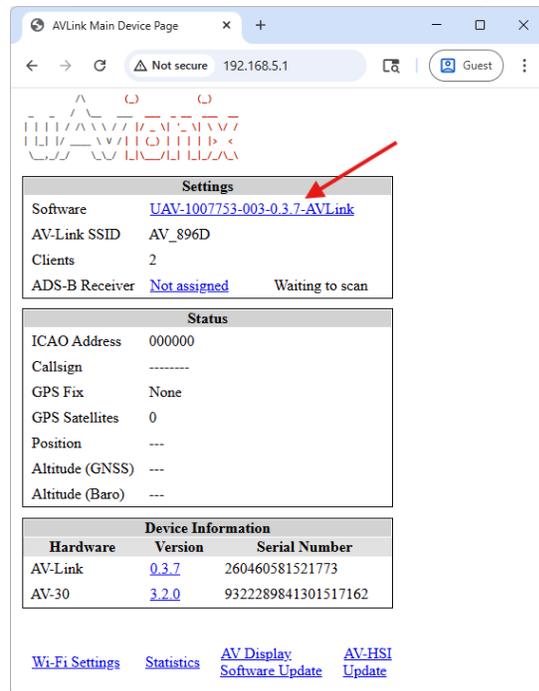

## **8. Post-Accomplishment Verification and Actions**

On restart, verify that the web page displays the correct AV-Link PMA version number and part number as listed in Table 3.

If all fields match, continue with these instructions. Otherwise, contact uAvionix Support.

## **9. System Checkout**

No specific system checkout procedure is required.

## **10. Support**

For additional questions or support please visit:

<http://www.uavionix.com/support/>

# 11. Maintenance Record

When post-accomplishment verification and system checkout is completed, make appropriate entries in the Aircraft Maintenance Log Book.

## Maintenance Record

Service Bulletin UAV-1008457-002 Rev A to install software v0.3.7 for AV-Link PMA UAV-1004414-001, AML STC SA00410BO, has been complied with.



**A copy of this form must be submitted by visiting: <https://uavionix.com/logbook/>**

Date:	By:
Aircraft Information	
Make:	Model:
Serial Number:	Registration Number:
AV-Link PMA Information	
Serial Number:	
Hardware Part Number:	UAV-1004414-001
Customer Information	
Name:	
Email:	
Telephone:	